
GRANDSTREAM NETWORKS

Firmware Release Notes
Firmware Version 1.0.4.2
Product Name: HT496/386

Firmware Version 1.0.3.99
Product Name: HT488
Date: March 12, 2008

SUMMARY OF UPDATES

The main purpose of this release is additional features implementing and addressing stability issues observed in previous releases.

CHANGES SINCE FIRMWARE RELEASE 1.0.3.96

BUG FIXES

- Fixed missing CRLF in NOTIFY as transferee
- Fixed SIP stack interprets Via header wrong
- Fixed device keeps ringing after SIP CANCEL the call
- Fixed Venezuela time zone
- Fixed device cannot recognize DTMF A, B, C and D
- Fixed device cannot register to Dynamic SIP server, using cached obsolete server IP
- Fixed we do not handle RTP padding causing noise on all codec
- Fixed DHCP option 60 is short cut
- Fixed HT488 no second dial tone for incoming PSTN call on FXO port
- Fixed SIP NOTIFY via Event: check-sync reset devices when busy

ENHANCEMENTS

- Added support for IVR error report
- Added configurable LEC support for HT386/496
- Add preventive check if UPDATE has SDP for re-INV

CONFIGURATION UPDATES

N/A

NOTES

N/A