
GRANDSTREAM NETWORKS

Firmware Release Notes
Firmware Version 1.0.3.9
Product Name: GXV36XX / GXV35XX
Date: May 7, 2010

Note: Firmware 1.0.3.9 has changed the default IP configuration to DHCP

SUMMARY OF UPDATES

The main purpose of this release is additional features implementing and addressing stability issues observed in previous releases.

CHANGES SINCE FIRMWARE RELEASE 1.0.2.3

BUG FIXES

- Fixed the device responds 488 instead of 486 when the number of incoming calls exceeds the maximum limitation
- Fixed GXV3601 HD, EPTZ screen will move to opposite direction when pressing LEFT or RIGHT
- Fixed the system time will be one hour off if "Synchronize with Local Computer" is set to Daylight Saving Time
- Fixed 3601 HD old hardware EPTZ shows green line
- Fixed changing Brightness, contrast and saturation do not take effect
- Fixed SIP User-agent field error
- Fixed with Broadsoft platform when client uses the sub-stream to watch video, device gsdvs process is restarted
- Fixed "Set the Time Manually" or "Synchronize with Local Computer" settings are overridden by "Update via NTP Server" after reboot
- Fixed Daylight Savings rule error
- Fixed if OSD "Include Text" is empty, no time will be shown in OSD
- Fixed H264 packetization-mode error
- Fixed GXV3601HD alarm won't generate photo when alarm is triggered
- Fixed setting "I-frame Interval" to minimum value caused the unit to restart

ENHANCEMENTS

- Changed the default IP configuration to DHCP
- Added support for 4 concurrent SIP calls
- Added support for changing channels while on the call by pressing 1/2/3/4
- Added support to auto start video after logging onto IE browser
- Added support for compatibility with Asterisk
- Added support for Asterisk record playback
- Added support so that plugging SD/MMS does not require a reboot to take effect
- Added support for audio only call
- Added support for including "-" character in SMTP/E-mail field
- New certificate for GSViewerX